



Dart Aerospace Ltd.
1270 Aberdeen St
Hawkesbury, ON
K6A 1K7
Canada

Tel (613) 632-5200
Fax 613 632-5246

①

D212-664-101TRN
Job Sheet 187525



Part No: D212-664-101TRN

Job Qty: 1 ea

Part Name: Crosstube Turning Detail



Part Weight: 0 lbs

Status: New

Priority: Medium

Job Created: 12/6/18

Job Tracking No:

Due Date: 12/21/18

Created By: Jesse White

Type: Stock

Description:

Note: DWG REV E IPP Rev:A 08-03-06 new issue DD verified by:ec IPP Rev B 08.04.02 removed Polish EC verified by: DD

Ship Via:

Bill of Materials

Job Routing

Op No	Operation	Qty	Start Date	Due Date	Standard		Workcenter/Supplier		Sign-off
					Setup Hrs	Run Hrs	Workcenter / Supplier	Lead Time	
90	Start up Operation	1 Ea		12/21/18	0.00	0.00	Start Up Crosstubes-1		MD/2018-12-10
100	Mori Seiki	1 pcs		12/21/18	4.40	2.38	Mori Seiki TL-40		MD/2018-12-11
110	QC	1 pcs		12/21/18	0.00	0.00	QC2-1		MD/2018-12-12
120	Mori Seiki	1 pcs		12/21/18	0.00	2.38	Mori Seiki TL-40		MD/2018-12-12
130	QC	1 pcs		12/21/18	0.00	0.00	QC2-1		GP 18-12-17
140	QC	1 pcs		12/21/18	0.00	0.00	QC8		GP 18-12-17
145	Crosstubes	1 pcs		12/21/18	0.00	0.68	Crosstubes-1		GP 18-12-17
150	HandFXtube	1 pcs		12/21/18	0.00	1.00	Crosstubes-3		DR 18/12/18
160	QC	1 pcs		12/21/18	0.00	0.00	QC7-1		DR 18-12-18
170	Packaging	1 pcs		12/21/18	0.00	0.00	Packaging3-1		DR 18-12-18
180	QC21-SA	1 Ea		12/21/18	0.00	0.00	QC21		21 DEC 19 2018

Part Op 100 - 1- Fill tube with sand & install plugs 212-141 on both ends as per Folio FA113 3- Turn first taper section on both side
Descriptions: as per folio FA113

120 - 1- Turn second taper on both side 4- Scribe part # and batch # using vibrating stylus on the cuff as per Dwg D212-664-141

145 - GRIND ONLY TRANSITION LINES SMOOTH LONGITUDE WAY.

150 - 1- handfinish X-TUBE INSIDE AND OUT

170 - LOCATION : LG014

Job BOM

Part / Item	Component Name	Quantity	Operation	Container
D6005-128	Crosstube Material	1 Ea (1 ea)	90-Start up Operation	B139414

Job Allocations

Operation	Component Part	Required	Inventory	Allocated
90-Start up Operation	D6005-128	1	43	0

Part Specifications

Specifications could not be found.

Entered: _____ Date: _____

WORK ORDER NON-CONFORMANCE / ROUTE UPDATE

NCR No. _____

Route update only ☐



DART
AEROSPACE
1270 Aberdeen Street
Hawkesbury, ON K6A 1K7
CANADA
TEL.: 1 813 632-5200
Email: sales@dartaero.com
www.dartaerospace.com

Container No: S136116
Part: D212-664-101TRN
Job No: 187525
Serial No/Batch: S136116

Revision: E
Inspector:
Exp Date:
Instructions:

Date: 12/10/18

DISPOSITION

Rework ☐
Scrap ☐
Use-as ☐

Job: _____

Part No. _____

Date: _____

Sequence #: _____

Description Work Order Deviation

Root Cause

Operator ☐
Manufacturing Process ☐
Equip/Tooling ☐
Handling/Preservation ☐
Material ☐
Product Improvement ☐
Process Improvement ☐
Human Factors ☐

FAULT CATEGORY

☐ Pressure/Forced	☐ Contamination	☐ Power Loss/Surge	☐ Positioned Wrong
☐ Bending	☐ Misaligned/off center	☐ Folio/Program	☐ Outside Tolerance
☐ Crushing	☐ BOM/Route	☐ Grain Direction	☐ Drawing
☐ Cracks	☐ Broken/Damage/Defect	☐ Weld	☐ Finish
☐ Crimp/Kink/Ripple/Wave/Twist	☐ Incomplete/Unclear Instructions	☐ Wrong Stock Pulled	☐ Part Lost/Missing
☐ Marks/Chatter	☐ Drill Holes	☐ Out of Sequence	☐ Misread
☐ Mislabeled	☐ Fit/Function	☐ Off-set/Set-up	

Other/Details: _____

①

DART AEROSPACE LTD	Work Order:	187525
Description: Crosstube Assembly (205/212/412 High Fwd)	Part Number:	D212-664-141
Inspection Dwg: D212-664-141 Rev: E		Page 1 of 2

FIRST ARTICLE INSPECTION CHECKLIST

	Inspection Sheet Drawing Dimension	Tolerance	Actual Dimension	Accept	Reject	Method of Inspection	Comments
SIDE A	0.200	+/-0.010	.205	✓		CNC-08	
	R0.063	+/-0.010	.063	✓		RG	
	2.740	+0.005/-0.000	2.743	✓		CNC-04	
	5.097	+/-0.030	5.108	✓		CNC-08	
	2.304	+0.005/-0.000	2.308	✓		CNC-04	
	2.340	+0.005/-0.000	2.345	✓			
	2.398	+0.005/-0.000	2.403	✓			
	2.448	+0.005/-0.000	2.453	✓			
	2.498	+0.005/-0.000	2.502	✓			
	2.549	+0.005/-0.000	2.554	✓			
	2.599	+0.005/-0.000	2.604	✓			
	2.671	+0.005/-0.000	2.676	✓			
	2.701	+0.005/-0.000	2.706	✓			
SIDE B	0.200	+/-0.010	.203	✓		CNC-08	
	R0.063	+/-0.010	.063	✓		RG	
	2.740	+0.005/-0.000	2.743	✓		CNC-04	
	5.097	+/-0.030	5.090	✓		CNC-08	
	2.304	+0.005/-0.000	2.309	✓		CNC-04	
	2.340	+0.005/-0.000	2.345	✓			
	2.398	+0.005/-0.000	2.403	✓			
	2.448	+0.005/-0.000	2.453	✓			
	2.498	+0.005/-0.000	2.502	✓			
	2.549	+0.005/-0.000	2.554	✓			
	2.599	+0.005/-0.000	2.604	✓			
	2.671	+0.005/-0.000	2.676	✓			
	2.701	+0.005/-0.000	2.706	✓			
	126.514	+/-0.020	126.510	✓		Tape	

Entered: _____ Date: _____



WORK ORDER NON-CONFORMANCE / ROUTE UPDATE

NCR No. _____


Route update only ☐

Job: _____ Part No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐	DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Eng. (Non-AW) ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Engineering ☐ Water Jet ☐ Supplier Quality ☐			
Date :	Sequence #:	QTY Affected :		MRB (QSI042)	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor	
Root Cause Operator ☐ Manufacturing Process ☐ Equip/Tooling ☐ Handling/Presservation ☐ Material ☐ Product Improvement ☐ Process Improvement ☐ Human Factors ☐		FAULT CATEGORY ☐ Pressure/Forced ☐ Bending ☐ Crushing ☐ Cracks ☐ Crimp/Kink/Ripple/Wave/Twist ☐ Marks/Chatter ☐ Mislabeled ☐ Contamination ☐ Misaligned/off center ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Incomplete/Unclear Instructions ☐ Drill Holes ☐ Fit/Function ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain Direction ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set/Set-up ☐ Positioned Wrong ☐ Outside Tolerance ☐ Drawing ☐ Finish ☐ Part Lost/Missing ☐ Misread			
Other/Details: _____					

①

DART AEROSPACE LTD	Work Order: 187525
Description: Crosstube Assembly (205/212/412 High Fwd)	Part Number: D212-664-141
Inspection Dwg: D212-664-141 Rev: E	Page 2 of 2

WALL THICKNESS MEASUREMENT

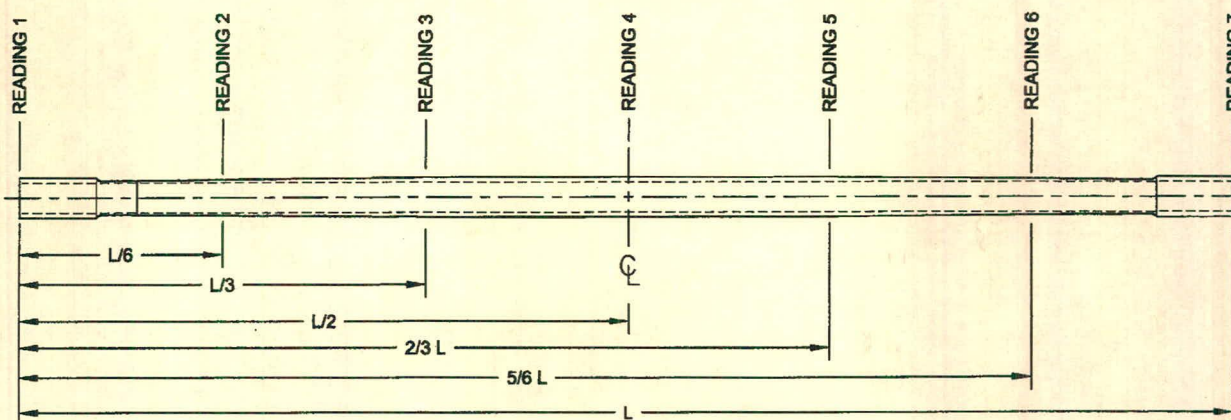

Location	WALL THICKNESS MEASUREMENT (IN)				Deviation Δw (max-min)	TOLERANCE
	w1	w2	w3	w4		
READING 1 L= 0"	.380	.386	.372	.363	.023	0.048"
READING 2 L= 21.09	.238	.255	.241	.221	.034	
READING 3 L= 42.17	.352	.357	.352	.346	.011	
READING 4 L= 63.25	.379	.382	.380	.387	.008	
READING 5 L= 84.34	.350	.355	.355	.348	.007	
READING 6 L= 105.43	.237	.236	.238	.239	.003	
READING 7 L= 126.514	.368	.378	.382	.374	.014	

Calibration Result

Actual Block Thickness: 200-400

Site Scan 250 Measured Thickness: 200-400

Measured by: MD
Date: 2018-12-12

Audited by: GP
Date: 2018-12-17

Preliminary Approval:
Date:

Rev	Date	Change	Revised by	Approved
C	07.05.28	Dwg Rev updated (P/O D412-664-101)	KJ/JLM	
D	10.02.02	Dimension 126.514 was 126.51	KJ	
E	12.06.04	Wall thickness form added	KJ	
F	14.06.05	Dwg Rev updated	KJ	

Entered: _____ Date: _____



WORK ORDER NON-CONFORMANCE / ROUTE UPDATE

NCR No. _____

Route update only ☐

Job: _____ Part No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐	DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Eng. (Non-AW) ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Engineering ☐ Water Jet ☐ Supplier ☐ Quality ☐			
Date :	Sequence #:	QTY Affected :		MRB (QSI042)	
Description Work Order Deviation		Disposition		Completed By	
8010				Lead hand / Supervisor	
				QC / QA Coordinator	
Root Cause Operator ☐ Manufacturing Process ☐ Equip/Tooling ☐ Handling/Presservation ☐ Material ☐ Product Improvement ☐ Process Improvement ☐ Human Factors ☐		FAULT CATEGORY ☐ Pressure/Forced ☐ Bending ☐ Crushing ☐ Cracks ☐ Crimp/Kink/Ripple/Wave/Twist ☐ Marks/Chatter ☐ Mislabeled ☐ Contamination ☐ Misaligned/off center ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Incomplete/Unclear Instructions ☐ Drill Holes ☐ Fit/Function ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain Direction ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set/Set-up ☐ Positioned Wrong ☐ Outside Tolerance ☐ Drawing ☐ Finish ☐ Part Lost/Missing ☐ Misread			
Other/Details:					

Item	Qty -141	Qty -141B	Qty -141F	Part Number	Description
1	X			D212-664-141	CROSSTUBE ASSEMBLY (205/212/412 HIGH FWD)
2		X		D212-664-141B	CROSSTUBE ASSEMBLY (214 HIGH FWD)
3			X	D212-664-141F	CROSSTUBE ASSEMBLY (205/212/412 HIGH FWD) (ANODIZED)
4	1	1	1	D6005-128	CROSSTUBE
5	2		2	D2893-1	SUPPORT
6	4	4	4	D3595-063-450	RUBBER CUSHION
7		2		D5017-1	SUPPORT
8	4	4	4	MS21920-25	CLAMP (OR MS21920-26)
9	A/R	A/R	A/R	PROSEAL 890 B-2	SEALANT, AMS-S-8802 CLASS B-2

GENERAL NOTES:

- MATERIAL: MANUFACTURED FROM D6005-128
FINISHED LENGTH = 126.514±0.020
- FINISH -141 & -141B: a) CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
b) PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
c) MASK UNDERSIDE OF CROSSTUBE AS SHOWN (ZN C6-2 / C6-3, HATCHED AREA)
d) PAINT OUTSIDE PER DART QSI 005 4.2
e) REMOVE MASKING AND APPLY MATTE CLEAR COAT
FINISH -141F: a) ANODIZE PER MIL-A-8625, TYPE II, CLASS 1.
b) ALODINE (DO NOT ETCH) PER QSI 005 4.1.2
c) PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
d) MASK UNDERSIDE OF CROSSTUBE AS SHOWN (ZN C6-2 / C6-3, HATCHED AREA)
e) PAINT OUTSIDE PER DART QSI 005 4.2
f) REMOVE MASKING AND APPLY MATTE CLEAR COAT
***NOTE:** BETWEEN FINISHING OPERATIONS EXTREME CARE MUST BE TAKEN NOT TO CONTAMINATE OR DAMAGE FINISHED SURFACES.
- TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED
- UNITS: INCHES UNLESS OTHERWISE NOTED.
- BREAK SHARP EDGES: 0.005 TO 0.010 MAX.
- IDENTIFICATION: SCRIBE DART PART NUMBER "D212-664-XXX" AND BATCH NUMBER ON INSIDE OF CUFF USING VIBRATING STYLUS
- WEIGHT: D212-664-141/-141B/-141F = 33.6 lbs
- PART IS SYMMETRIC ABOUT CENTERLINE.
- EXTREME CARE MUST BE TAKEN TO PROTECT THE OUTSIDE SURFACE OF THE TUBE. THE OUTSIDE SURFACE MUST BE SMOOTH AND FREE FROM SURFACE DEFECTS SUCH AS SCRATCHES, NICKS, OR DENTS. DEFECTS UP TO 0.005" MAY BE BLENDED OUT LONGITUDINALLY. CIRCUMFERENTIAL GRIND MARKS ARE UNACCEPTABLE.

MACHINING

- RUN CUTTER OFF PART. BLEND OUT EDGE LONGITUDINALLY, TRANSITION SHOULD BE SMOOTH.

BENDING

- BEND PROGRESSIVELY WITH A MINIMUM OF 3 PASSES. MAXIMUM TUBE FLATTENING DUE TO BENDING IS 7.2% (BASED ON O.D.) IN LOWER HALF OF R35.5 BEND AND 6% (BASED ON O.D.) ON REMAINING TUBE.
- LIQUID PENETRANT INSPECT OUTSIDE SURFACE OF CROSSTUBE PER QSI 038.

ASSEMBLY

- TO INSTALL D2893-1 / D5017-1 SUPPORT: ABRASE MATING SURFACE OF SUPPORT AND CROSSTUBE WITH 180-GRIT SANDPAPER AND REMOVE RESIDUE WITH MEK (OR EQUIVALENT). APPLY A 0.04" TO 0.07" THICK LAYER OF PROSEAL 890 CLASS B-2 (OR AMS-S-8802 CLASS B-2) SEALANT TO MATING SURFACE OF SUPPORT.
- INSTALL MS21920-25 CLAMPS (OR -26) WITH D3595-063-450 RUBBER CUSHIONS TO SECURE THE SUPPORT ON TOP SIDE OF THE CROSSTUBE. ENSURE CLAMPS ARE ON TOP SIDE OF CROSSTUBE.
- TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING. PRIOR TO PACKAGING, RE-CHECK TORQUE ON CLAMPS AFTER PROSEAL 890 SEALANT HAS CURED FOR 72 HOURS.

RELEASED
2014-05-26
WJD

E	ADD -141F. D5017-1 WAS D2893-1 (-141B), PROSEAL WAS MAGNOBOND, NOTE 2: ADD INSPECTION WINDOW, NOTE 11: ALLOW 7.2% CRUSH, NOTE 15: ADD 72HR CURE AND RETORQUE FOR PROSEAL, ADD SHEET 3, CLAMPS REVERSED TO PREVENT CHAFING (B7-2, B7-3), BEND HEIGHT TOL. NOW 0.25 WAS 0.13 (C1-3), INCOMP. DEO D-1/-2/-3	CP	14.04.01
D	REFORMAT/REVISE GENERAL NOTES/PART LIST; REORGANIZED VIEWS AND REFORMATTED DRAWING TO CURRENT STANDARDS; ADD -141B (ZN B4-2, D4-2); REMOVED REF & ADD TOLERANCES (ZN B4-3, C6-3, C6-3 & B6-3); RELOCATED FLAG #6 PER PAR 08-046 (ZN A5-3); MOVED TURNING DETAIL & UPDATED TOLERANCE TO SHEET 4	RF	09.09.30
C	REMOVE -851 ABRASION STRIP; ADD MAGNOBOND 6398, CUSHION, REVERSE CLAMPS	PH	07.03.08
B	ADD HOLES FOR COMPATABILITY WITH BHT/AA SKIDTUBES	PH	05.02.04
A	NEW ISSUE	CP	00.12.12
REV.	DESCRIPTION	BY	DATE
DESIGN			
DRAWN			
CHECKED			
MFG. APPR.			
APPROVED			
DE APPR.			
DATE	14.04.01		

DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
DRAWING NO. D212-664-141	REV. E SHEET 1 OF 5
TITLE XTUBE ASS'Y (205/212/412 HI FWD)	SCALE NTS
COPYRIGHT © 2000 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

Entered: _____ Date: _____





WORK ORDER NON-CONFORMANCE / ROUTE UPDATE

NCR No. _____

Route update only ☐

Job: _____ Part No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐	DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Eng. (Non-AW) ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Engineering ☐ Water Jet ☐ Supplier ☐ Quality ☐			
Date :	Sequence #:	QTY Affected :		MRB (QSI042)	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor	
Root Cause Operator ☐ Manufacturing Process ☐ Equip/Tooling ☐ Handling/Presservation ☐ Material ☐ Product Improvement ☐ Process Improvement ☐ Human Factors ☐		FAULT CATEGORY ☐ Pressure/Forced ☐ Bending ☐ Crushing ☐ Cracks ☐ Crimp/Kink/Ripple/Wave/Twist ☐ Marks/Chatter ☐ Mislabeled ☐ Contamination ☐ Misaligned/off center ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Incomplete/Unclear Instructions ☐ Drill Holes ☐ Fit/Function ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain Direction ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set/Set-up ☐ Positioned Wrong ☐ Outside Tolerance ☐ Drawing ☐ Finish ☐ Part Lost/Missing ☐ Misread			
Other/Details:					

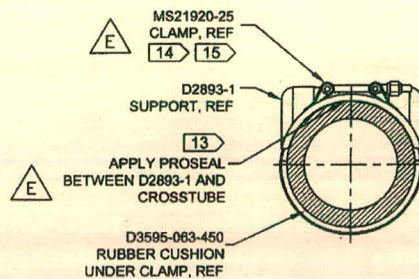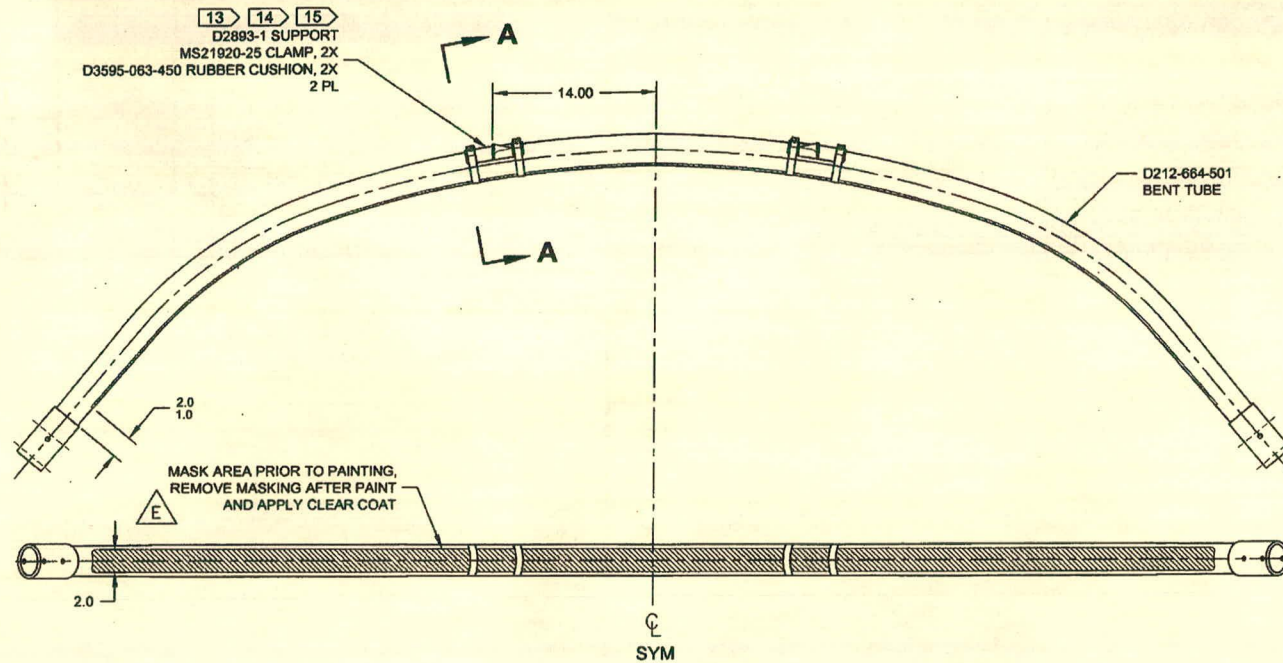

SECTION A-A
SCALE 4X

D212-664-141/-141F
ASSEMBLY DETAIL

RELEASED
2014-05-26
AND

DESIGN	90	DART AEROSPACE LTD	
DRAWN	90	HAWKESBURY, ONTARIO, CANADA	
CHECKED	90	DRAWING NO.	REV. E
MFG. APPR.	90	D212-664-141	SHEET 2 OF 5
APPROVED	90	TITLE	SCALE
DE APPR.	90	XTUBE ASS'Y (205/212/412 HI FWD)	NTS
DATE	14.04.01	COPYRIGHT © 2000 BY DART AEROSPACE LTD	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.			

Entered: _____ Date: _____




WORK ORDER NON-CONFORMANCE / ROUTE UPDATE


NCR No. _____

Route update only ☐

Job: _____ Part No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐		DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Eng. (Non-AW) ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Engineering ☐ Water Jet ☐ Supplier ☐ Quality ☐																															
Date : _____		Sequence #: _____		QTY Affected : _____		MRB (QSI042)																													
Description Work Order Deviation				Disposition																															
				Completed By																															
				Lead hand / Supervisor																															
				QC / QA Coordinator																															
Root Cause Operator ☐ Manufacturing Process ☐ Equip/Tooling ☐ Handling/Presservation ☐ Material ☐ Product Improvement ☐ Process Improvement ☐ Human Factors ☐		FAULT CATEGORY <table border="0"><tr><td>☐ Pressure/Forced</td><td>☐ Contamination</td><td>☐ Power Loss/Surge</td><td>☐ Positioned Wrong</td></tr><tr><td>☐ Bending</td><td>☐ Misaligned/off center</td><td>☐ Folio/Program</td><td>☐ Outside Tolerance</td></tr><tr><td>☐ Crushing</td><td>☐ BOM/Route</td><td>☐ Grain Direction</td><td>☐ Drawing</td></tr><tr><td>☐ Cracks</td><td>☐ Broken/Damage/Defect</td><td>☐ Weld</td><td>☐ Finish</td></tr><tr><td>☐ Crimp/Kink/Ripple/Wave/Twist</td><td>☐ Incomplete/Unclear Instructions</td><td>☐ Wrong Stock Pulled</td><td>☐ Part Lost/Missing</td></tr><tr><td>☐ Marks/Chatter</td><td>☐ Drill Holes</td><td>☐ Out of Sequence</td><td>☐ Misread</td></tr><tr><td>☐ Mislabeled</td><td>☐ Fit/Function</td><td>☐ Off-set/Set-up</td><td></td></tr></table>						☐ Pressure/Forced	☐ Contamination	☐ Power Loss/Surge	☐ Positioned Wrong	☐ Bending	☐ Misaligned/off center	☐ Folio/Program	☐ Outside Tolerance	☐ Crushing	☐ BOM/Route	☐ Grain Direction	☐ Drawing	☐ Cracks	☐ Broken/Damage/Defect	☐ Weld	☐ Finish	☐ Crimp/Kink/Ripple/Wave/Twist	☐ Incomplete/Unclear Instructions	☐ Wrong Stock Pulled	☐ Part Lost/Missing	☐ Marks/Chatter	☐ Drill Holes	☐ Out of Sequence	☐ Misread	☐ Mislabeled	☐ Fit/Function	☐ Off-set/Set-up	
☐ Pressure/Forced	☐ Contamination	☐ Power Loss/Surge	☐ Positioned Wrong																																
☐ Bending	☐ Misaligned/off center	☐ Folio/Program	☐ Outside Tolerance																																
☐ Crushing	☐ BOM/Route	☐ Grain Direction	☐ Drawing																																
☐ Cracks	☐ Broken/Damage/Defect	☐ Weld	☐ Finish																																
☐ Crimp/Kink/Ripple/Wave/Twist	☐ Incomplete/Unclear Instructions	☐ Wrong Stock Pulled	☐ Part Lost/Missing																																
☐ Marks/Chatter	☐ Drill Holes	☐ Out of Sequence	☐ Misread																																
☐ Mislabeled	☐ Fit/Function	☐ Off-set/Set-up																																	
		Other/Details:																																	

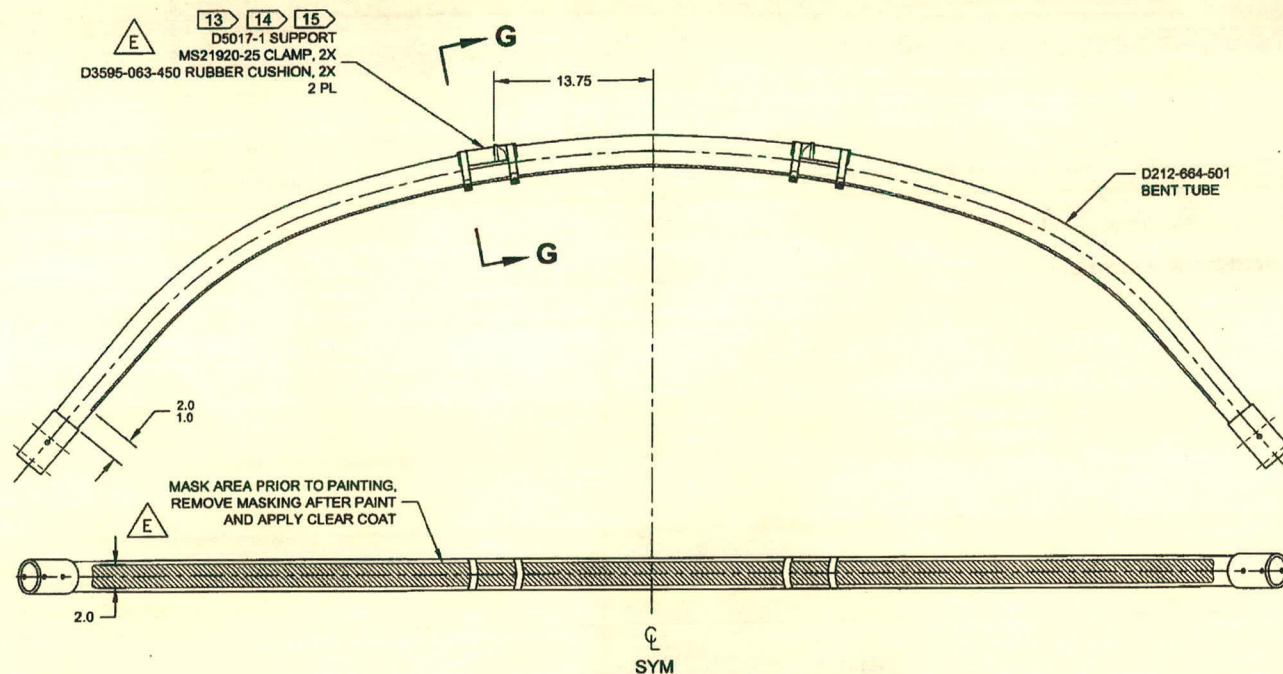

D212-664-141B
ASSEMBLY DETAIL

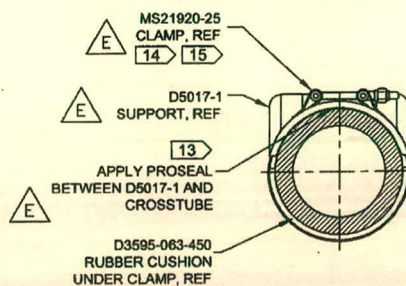

SECTION G-G
SCALE 4X

RELEASED
2014-05-26

DESIGN		DART AEROSPACE LTD	
DRAWN		HAWKESBURY, ONTARIO, CANADA	
CHECKED		DRAWING NO.	REV. E
MFG. APPR.		D212-664-141	SHEET 3 OF 5
APPROVED		TITLE	SCALE
DE APPR.		XTUBE ASS'Y (205/212/412 HI FWD)	NTS
DATE	14.04.01	COPYRIGHT © 2000 BY DART AEROSPACE LTD	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.			

Entered: _____ Date: _____




WORK ORDER NON-CONFORMANCE / ROUTE UPDATE



NCR No. _____

Route update only ☐

Job: _____ Part No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐	DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Eng. (Non-AW) ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Engineering ☐ Water Jet ☐ Supplier ☐ Quality ☐			
Date :	Sequence #:	QTY Affected :		MRB (QSI042)	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor	
				QC / QA Coordinator	
Root Cause Operator ☐ Manufacturing Process ☐ Equip/Tooling ☐ Handling/Presservation ☐ Material ☐ Product Improvement ☐ Process Improvement ☐ Human Factors ☐ ☐ Pressure/Forced ☐ Bending ☐ Crushing ☐ Cracks ☐ Crimp/Kink/Ripple/Wave/Twist ☐ Marks/Chatter ☐ Mislabeled		FAULT CATEGORY ☐ Contamination ☐ Misaligned/off center ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Incomplete/Unclear Instructions ☐ Drill Holes ☐ Fit/Function ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain Direction ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set/Set-up ☐ Positioned Wrong ☐ Outside Tolerance ☐ Drawing ☐ Finish ☐ Part Lost/Missing ☐ Misread			
Other/Details:					

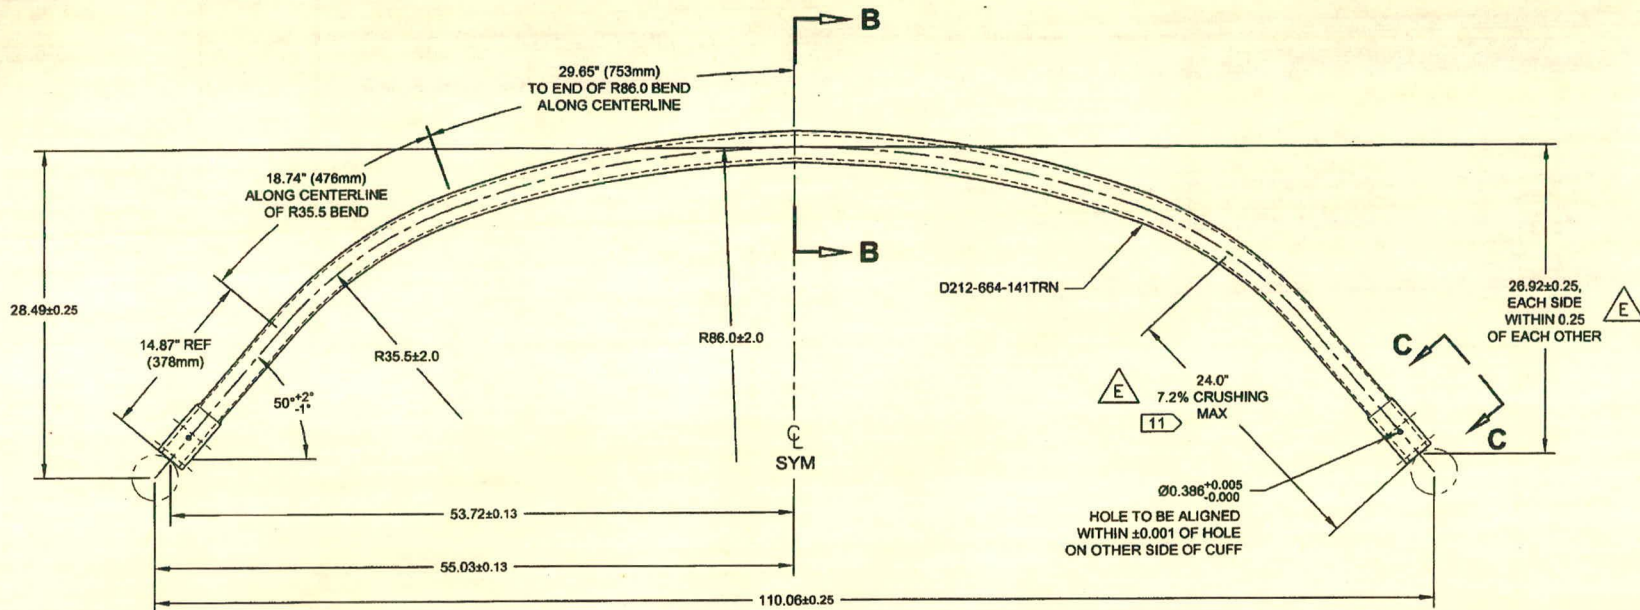

D212-664-501
BENDING AND DRILLING DETAIL [11]

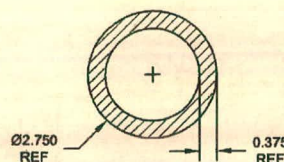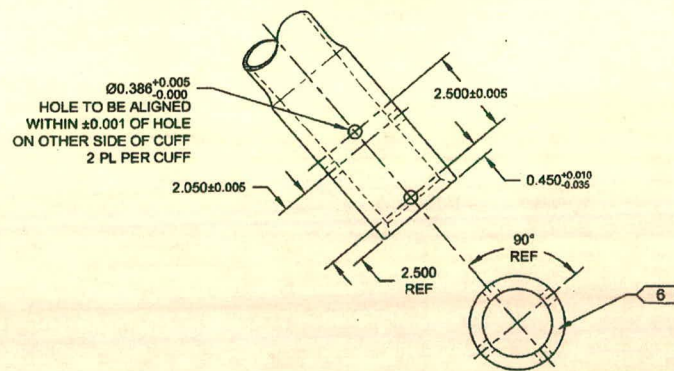

RELEASED
2014-05-26

DESIGN	<i>90</i>	DART AEROSPACE LTD	
DRAWN	<i>90</i>	HAWKESBURY, ONTARIO, CANADA	
CHECKED	<i>90</i>	DRAWING NO.	REV. E
MFG. APPR.	<i>90</i>	D212-664-141	SHEET 4 OF 5
APPROVED	<i>90</i>	TITLE	SCALE
DE APPR.	<i>90</i>	XTUBE ASS'Y (205/212/412 HI FWD)	NTS
DATE	14.04.01	COPYRIGHT © 2000 BY DART AEROSPACE LTD	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.			

Entered: _____ Date: _____





WORK ORDER NON-CONFORMANCE / ROUTE UPDATE

NCR No. _____


Route update only ☐

Job: _____ Part No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐	DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Eng. (Non-AW) ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Engineering ☐ Water Jet ☐ Supplier ☐ Quality ☐			
Date :	Sequence #:	QTY Affected :		MRB (QSI042)	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor	
				QC / QA Coordinator	
Root Cause Operator ☐ Manufacturing Process ☐ Equip/Tooling ☐ Handling/Presservation ☐ Material ☐ Product Improvement ☐ Process Improvement ☐ Human Factors ☐ ☐ Pressure/Forced ☐ Bending ☐ Crushing ☐ Cracks ☐ Crimp/Kink/Ripple/Wave/Twist ☐ Marks/Chatter ☐ Mislabeled		FAULT CATEGORY ☐ Contamination ☐ Misaligned/off center ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Incomplete/Unclear Instructions ☐ Drill Holes ☐ Fit/Function ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain Direction ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set/Set-up ☐ Positioned Wrong ☐ Outside Tolerance ☐ Drawing ☐ Finish ☐ Part Lost/Missing ☐ Misread			

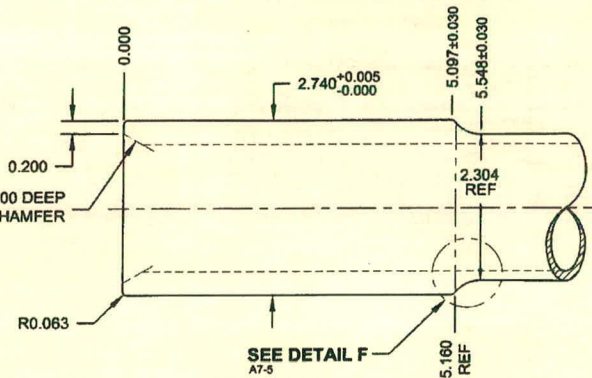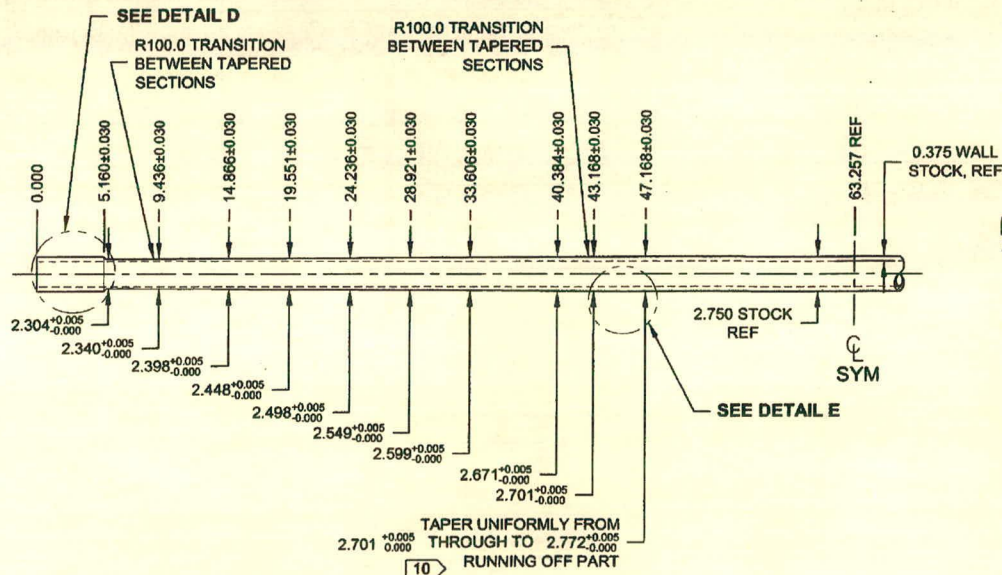


DETAIL D:
CROSSTUBE CUFF
SCALE 5X

D212-664-141TRN
TURNING DETAIL

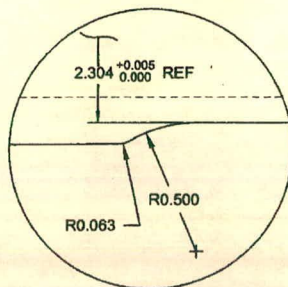

DETAIL F:
CUFF TRANSITION
SCALE 10X

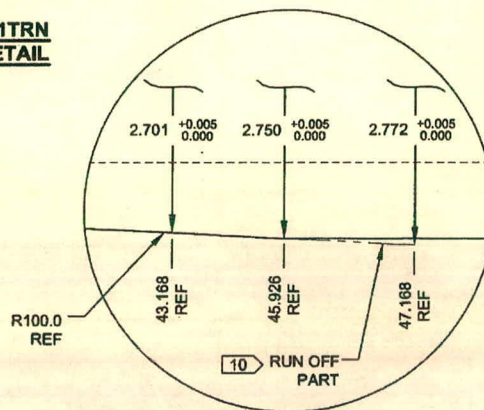

DETAIL E:
TAPER RUN-OFF
NOT TO SCALE

RELEASED
2014-05-26

DESIGN	<i>JD</i>	DART AEROSPACE LTD	
DRAWN	<i>JD</i>	HAWKESBURY, ONTARIO, CANADA	
CHECKED	<i>JD</i>	DRAWING NO.	REV. E
MFG. APPR.	<i>[Signature]</i>	D212-664-141	SHEET 5 OF 5
APPROVED	<i>[Signature]</i>	TITLE	SCALE
DE APPR.	<i>[Signature]</i>	XTUBE ASS'Y (205/212/412 HI FWD)	NTS
DATE	14.04.01	COPYRIGHT © 2006 BY DART AEROSPACE LTD	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR REPRODUCED IN ANY FORM OR BY ANY MEANS WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.			

Entered: _____ Date: _____



WORK ORDER NON-CONFORMANCE / ROUTE UPDATE

NCR No. _____

Route update only ☐

Job: _____ Part No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐		DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Eng. (Non-AW) ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Engineering ☐ Water Jet ☐ Supplier ☐ Quality ☐			
Date : _____		Sequence #: _____		QTY Affected : _____		MRB (QSI042)	
Description Work Order Deviation				Disposition			
				Completed By			
				Lead hand / Supervisor			
				QC / QA Coordinator			
Root Cause Operator ☐ Manufacturing Process ☐ Equip/Tooling ☐ Handling/Presservation ☐ Material ☐ Product Improvement ☐ Process Improvement ☐ Human Factors ☐		FAULT CATEGORY ☐ Pressure/Forced ☐ Bending ☐ Crushing ☐ Cracks ☐ Crimp/Kink/Ripple/Wave/Twist ☐ Marks/Chatter ☐ Mislabeled ☐ Contamination ☐ Misaligned/off center ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Incomplete/Unclear Instructions ☐ Drill Holes ☐ Fit/Function ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain Direction ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set/Set-up ☐ Positioned Wrong ☐ Outside Tolerance ☐ Drawing ☐ Finish ☐ Part Lost/Missing ☐ Misread					
		Other/Details:					